

**!! Please check for any possible firmware update available on [www.reloop.com/reloop-mixon-8-pro](http://www.reloop.com/reloop-mixon-8-pro) !!**

### SUPPORTED SYSTEMS

- Windows 10
- Windows 11
- macOS 11 Big Sur
- macOS 12 Monterey
- macOS 13 Ventura
- macOS 14 Sonoma

Older operating systems may work but are unsupported.

### CHECK CURRENTLY INSTALLED FIRMWARE ON DEVICE

1. Make sure the device is powered off
2. Hold the "Back"-button while powering on your unit

**>> The current firmware version will be shown on both displays (e.g.: v4735)**

If the firmware version matches with the latest version available, no update is required.


### UPDATE INSTRUCTIONS FOR macOS AND Windows

Please make sure Serato DJ Pro / djay Pro AI or any other application is closed before doing the update.


1. Power off the Mixon 8 Pro via the power switch on the rear side
2. Connect the Mixon 8 Pro via the USB B port on the rear panel to your computer via the USB cable

**Note: The USB cable must be connected to the USB B port on your controller. The update will not work on the USB A port.**


3. Hold the „Back“-button while powering on your unit

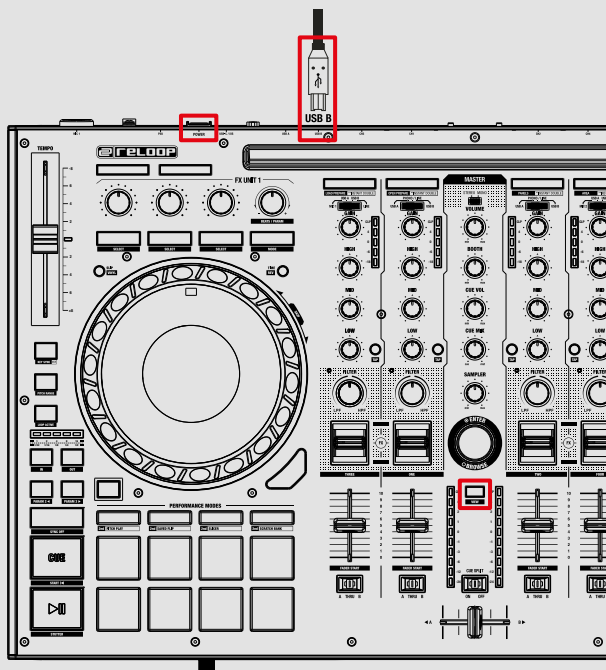


4. Open the firmware updater app for your OS (macOS\* / Windows)

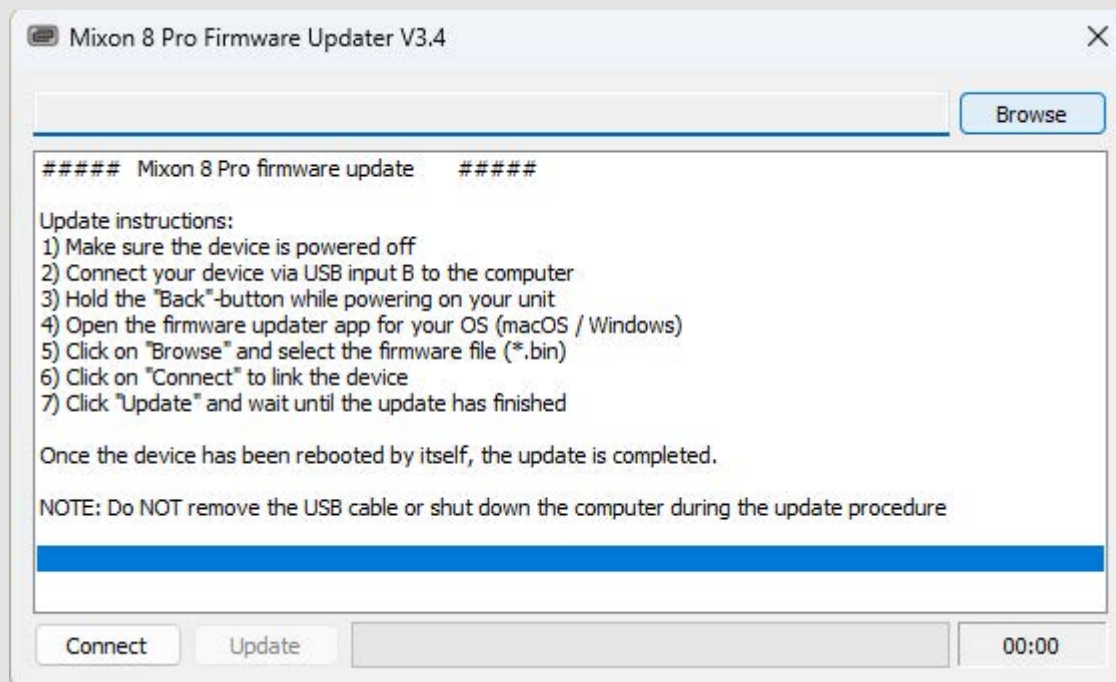

5. Click on „Browse“ and select the firmware file (\*.bin)
6. Click on „Connect“ to link the device

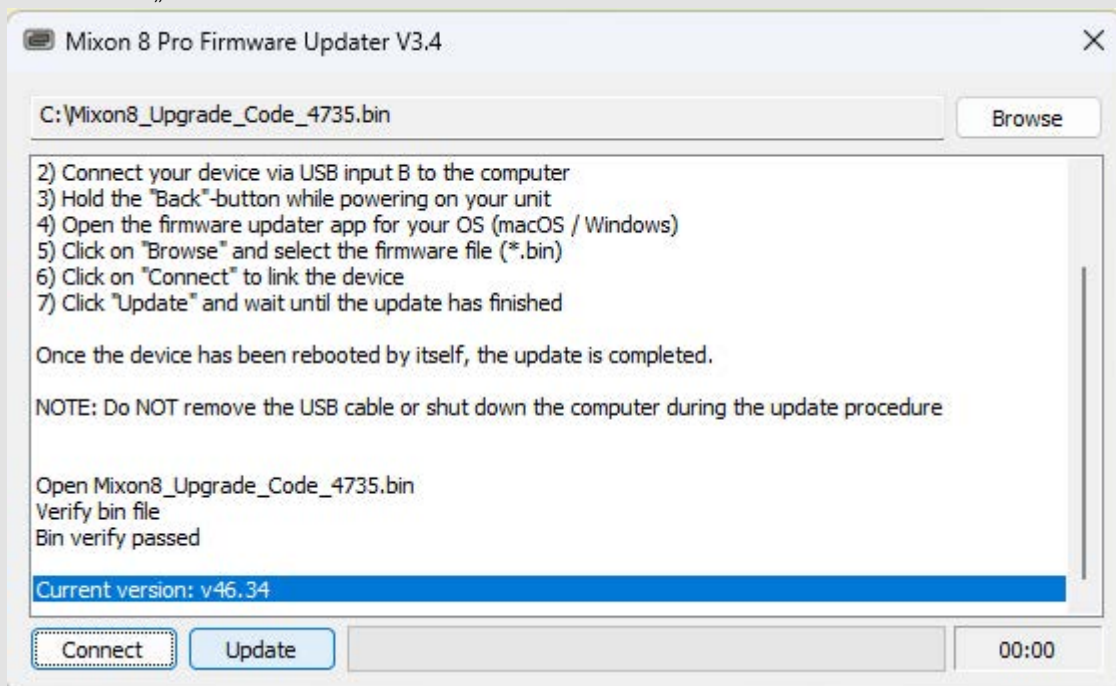

7. Click „Update“ and wait until the update has finished

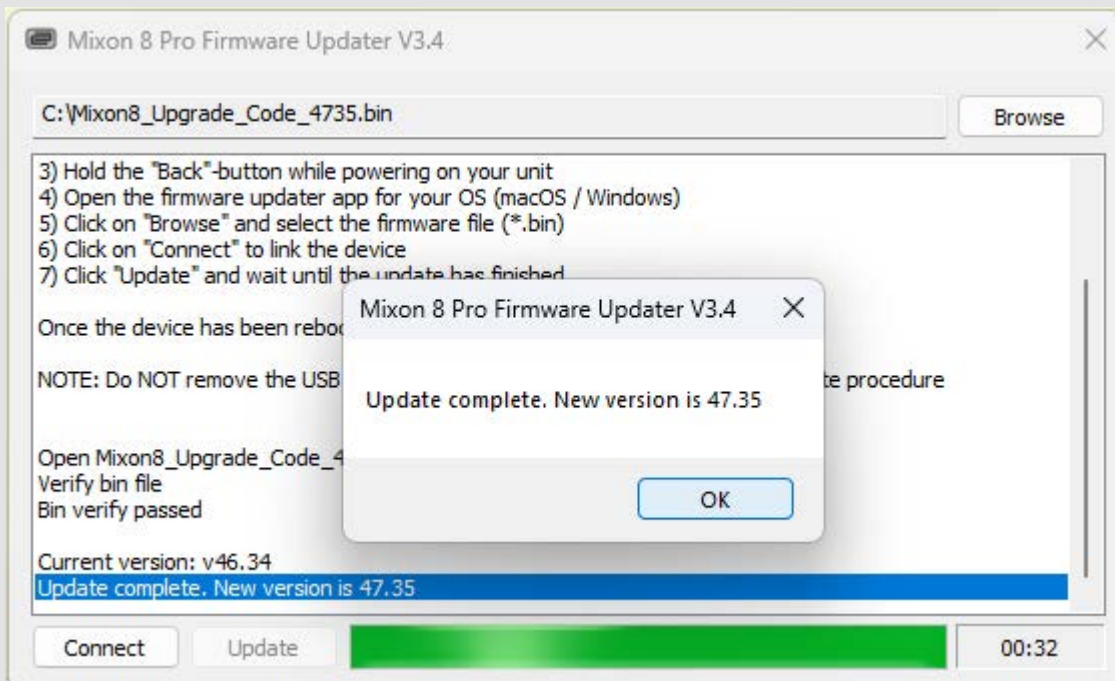

Once the “Update complete” message appears within the updater, the device’s firmware now has successfully been updated and the Mixon 8 Pro mixer can be powered off.

**NOTE: Do NOT remove the USB cable or shut down the computer during the update procedure**

You will also find all instructions above in our [tutorial series](#).

\*: In case of a warning message on macOS 10.13 or higher, please do the following steps to proceed:

1. Go into your system preferences by clicking on the Apple icon and select „System preferences“
2. Select „Security & Privacy“ and be sure the „General“ tab is selected
3. Click on „Allow“

The updater application should now open. If not, just double-click the application.again.

## CHANGE HISTORY

### version 5339 (14th Juni 2024)

- Auto-detection was added due to a VR component change in the latest production batch

### version 5039 (24th August 2023)

- Added Pitch Fader MIDI command for Shift layer
- Improved initial software pick-up of controls

- Improved stability of Lightning devices
- Various stability improvements

**version 4936 (15th June 2023)**

- FX OFF not sent when paddles toggled off simultaneously (fixed)
- Fader Start for Crossfader right side does not send any MIDI Notes (fixed)
- Crossfader assignment considered for Crossfader Start
- When Cue Split is enabled, blending between Master and Cue signal via Cue Mix does not work (fixed)

**version 4735 (15th May 2023)**

- various stability improvements